

KB/OSA

~~SECRET~~

25X1A

[ ]-2670-63  
Copy 10 of 10

8 May 1963

MEMORANDUM FOR: Deputy Assistant Director, OSA

SUBJECT : Project OXCART - Security  
(Foreign Object Damage to Engines

25X1A

[ ]

25X1A

REFERENCE : [ ]-2631-63 dtd 30 Apr 63, To: DAD/OSA,  
Frm: C/SS/OSA, Subj: As Above

25X1A

25X1A

1. As a result of the continued FOD problem [ ]  
[ ], Assistant Security Officer,  
OSA-DD/R, on 1-3 May 1963, conducted a review of Security  
procedures in effect [ ] This memorandum is to  
record Security actions initiated and anticipated, and  
to record Staff discussions held [ ] during that  
period.

25X1A

25X1A

25X1A

2. The conclusions reached during these discussions  
are: (1) FOD has been somewhat corrected by installation  
of screens in the bleed by-pass doors; this correction has  
been one of degree; (2) FOD may be considerably reduced by  
the installation of "flapper valves" within the nacelle area,  
designed to eliminate damage caused by reverse airflow of  
secondary air experienced during ground runs; and (3) FOD  
is most probably attributable in some degree to laxity in  
the physical management of the flight test program [ ]  
[ ], particularly in the areas of housekeeping, aircraft  
maintenance and quality control inspection procedures.

25X1A

3. FOD has been a continuing problem [ ] since  
June 1962. (Attachment #1 records a chronological history  
of FOD to date.) On 2 May engine #219 experienced major  
FOD, after having been installed for 35 minutes in the left  
nacelle of Aircraft #121. Similar damage was experienced  
in the same nacelle on 26 April 1963 while engine #216 was

25X1A

25X1A

Handle via [ ]  
Control System

~~SECRET~~

~~SECRET~~

25X1A

[ ]-2670-63  
Page 2

installed. During the interim, 26 April - 3 May, engine #216 had been installed (on 1 May) in Aircraft #126 and used as a "vacuum cleaner" without resultant FOD. As a result of the 2 May FOD on #219 engine, Project Headquarters directed initiation of a thorough investigation by all appropriate components [ ]. The Security Staff was directed to investigate the possibility of Sabotage.

25X1A

25X1A

4. On 2 May 1963 the Chief, Security Staff/OSA, directed [ ] the Security Officer, [ ] to address his full efforts to several specific areas of concern. The specific directives and the security actions taken to date are summarized as follows:

25X1A

a. Review access procedures to aircraft and consider maintaining access log. The [ ] Security Office has in operation a long established compartmentation system. Individuals are granted access to physical areas within the Test Site on an "as needed basis." Currently there are six (6) aircraft in place, housed in two hangars. Approximately [ ] people require access to these hangars. Access is authorized by the inclusion of a figure 1 on their security badge, which must be worn exposed at all times. On 2 May, the Security Officer, [ ] and [ ] discussed with the Base Commander, [ ], and Mr. Clarence L. (Kelly) Johnson, Vice President, Lockheed Aircraft Corp., a possible reduction in the number of people having such access. It was unanimously agreed that present access standards are satisfactory. On 3 May it was decided that during non-working periods in the future, the Security guard assigned to the hangar area is to maintain a written log of all personnel entering the hangar.

25X1A

25X1A

25X1A  
25X1A

b. Assure that Security Personnel are constantly alert to possible Sabotage. Security personnel are periodically rebriefed on the necessity to be alert to saboteurs. As of 2 May a Security Guard will be permanently assigned, on a 24-hour-a-day basis, to each hangar. It must be realized, however, that we are dealing with hangars large enough to house three Project

~~SECRET~~

SECRET

25X1A

[ ]-2670-63

Page 3

Aircraft. The aircraft is, in itself, large and complex; while in the hangar it is often broken down for maintenance and the interior of the hangar often gives the appearance of a titanium jungle. At any given moment one guard could attend to about one percent of the entire hangar area.

c. Encourage reporting to Security Office by key contractor personnel and staff personnel of any disaffection and unusual conduct by subordinate employees.

25X1A This type of reporting has been an established SOP since [ ] commenced operation. [ ] Security Officer solicits this type of reporting during EOD briefings. In this regard, the cooperation with the 25X1A [ ] Security Officer has been unanimous with one exception, Lockheed. LAC Flight Test Management has consistently 25X1A refused to cooperate with [ ] Security Office in this regard. For example, (1) LAC is the only contractor firm 25X1A represented [ ] which refuses to permit periodic 25X1A Security rebriefings of personnel by [ ] Security Officer; (2) the LAC Director of Flight Test recently 25X1A refused, upon request, to submit to [ ] Security Officer a copy of his critique of FOD; (3) during March-April 1963 a petition, listing several grievances concerning facilities [ ] and signed by [ ] LAC 25X1A union personnel, was submitted to Mr. C. L. Johnson; neither [ ] Security Officer nor Project Headquarters 25X1A was notified of the discontent.

d. Develop sources within the work force.

Since LAC is the principal contractor involved, attention must be directed to that Company. Approximately 75 percent of the Contractor personnel on Site are employed by LAC, and no difficulties have been encountered with other Contractor personnel. The development of Confidential Contractor Informants is a delicate consideration; the potential labor-management conflicts resulting from such a program are somewhat prohibitive 25X1A

25X1A On 2 May, Mr. C. L. Johnson discussed with [ ] the possibility of integrating a [ ]

SECRET

SECRET

25X1A

[ ]-2670-63  
Page 4

CI man into the LAC work force. The extensive area of activity would be extremely difficult for one man; indeed, five men would be a mere beginning. Consequently, consideration was given to developing long term, proven employees within the LAC group who have been formerly associated with this Agency.

Development of these employees is, again, a delicate situation. Labor-management implications are serious. Consequently, the undersigned requested [ ], West Coast Security Officer at LAC, to coordinate this technique with LAC Security. 25X1A

25X1A To date [ ] has, on an informal basis, developed three members of the LAC work force for this purpose.

e. Review Security files of personnel having access to Vehicle.

25X1A

25X1A As was stated above, approximately [ ] people at [ ] have access to the Vehicle. Information available to [ ] Security Officer indicated that a Security file review should commence with LAC Quality Control Inspectors as they are normally the last persons to closely survey the area of interest. Furthermore, one of the Inspectors, [ ] LAC, is the one individual at [ ] who has been described as a somewhat disgruntled employee and rabble rouser. The files of all LAC inspectors (fifteen in number) were reviewed by Headquarters Security and [ ] Security with favorable results on 2 May 1963. 25X1A 25X1A

25X1A The files of the [ ] firemen, [ ] and employees, personnel who are normally in close proximity to the Vehicle immediately prior to engine start, will be reviewed by Project Headquarters.

At the request of Deputy for Technology/OSA, the LAC personnel currently assigned to the night shift will be reviewed.

SECRET

~~SECRET~~

25X1A

[redacted]-2670-63  
Page 5

25X1A f. Possibility of use of TV cameras in hangar areas. The extensive area to be covered and the mobility required, in the opinion of [redacted], preclude the use of TV or other photo equipment.

25X1A

5. On 3 May 1963, a meeting was held at [redacted] to explore all possible causes of FOD. In attendance were the following:

Project Headquarters

Mr. John Parangosky

25X1A

[redacted]

25X1A

[redacted]

25X1A

[redacted]

Burbank

25X1A

[redacted]

6. Detailed reporting of this meeting is available from Deputy for Technology. Considerable discussion was devoted to the use of screens on the engine by-pass doors and the use of flapper valves against reverse air flow. Both fixes represent possible solutions to FOD. The flapper valves should be available for installation in approximately two weeks.

a. Consideration was again given to the possibility of sabotage. Consequently, the following actions were decided upon: 25X1A

(1) [redacted] will determine the identities of personnel who signed the grievance petition mentioned in paragraph 3c. above and submit the names to Project Headquarters for Office of Security file review. 25X1A

(2) [redacted] will determine the nature of the grievances and corrective action taken.

~~SECRET~~

SECRET

25X1A

[redacted]-2670-63  
Page 6

25X1A [redacted] 25X1A [redacted] will interview [redacted] 25X1A [redacted] former LAC engineer who recently resigned [redacted] reportedly because of his disenchantment with LAC management policies [redacted]

25X1A

25X1A  
25X1

b. Every effort was made to determine patterns on the FOD; there are none. However, the following factors pertain to 90 percent of the FOD: (1) FOD occurs during ground run; (2) FOD occurs during military power or above; (3) FOD occurs after some modification of the nacelle. The latter characteristic was proven by the history of Aircraft 121; and the history of Aircraft 121 tends to limit the geographical area of concern to [redacted]

25X1A

25X1A

c. The most significant revelations at the 3 May meeting concerned the management, maintenance, and inspection policies and procedures currently utilized by LAC at [redacted]. [redacted] the Director of Operations; [redacted] Director of Materiel; [redacted] Airframe Specialist/OSA; and [redacted] Engine Specialist/OSA, were unanimously appalled at the careless approach of LAC. Among the significant revelations made were:

25X1A

25X1A

25X1A

25X1A

25X1A

25X1A

25X1A

(1) The Flight Test Program [redacted] is managed by [redacted] who, regardless of personal competency, pursue a dictatorial personnel policy and often irritate the hourly employees.

25X1A

(2) Indications of frictions within LAC Engineering-Supervisory groups and generally poor morale.

(3) Contrary to Mr. Johnson's February 1963 statement that corrective action had been taken, LAC employees work in generally dirty environment. No corrective action has been taken to sterilize workers' clothing, even though mechanics are working in most delicate areas of the aircraft, e.g. nacelle. It was

SECRET

~~SECRET~~

25X1A

[ ]-2670-63  
Page 7

pointed out that in normal aircraft production, many precautions are taken along these lines, e.g., "bunny suit coveralls."

(4) There are no standardized procedures for maintenance or inspection; each aircraft seems to be handled differently.

(5) Work in the Spike-Control Area is carelessly done. This is a prime area of concern and suspect cause of FOD. The record shows that aircraft 123 and 124 have had little or no FOD because they fly with the Spike locked; others fly with movable Spike.

(6) Definite absence of close supervision of aircraft crews.

(7) Definite lack of check list procedures during maintenance and inspection.

25X1A

25X1A

7. It is the opinion of [ ] that the FOD problem [ ] is predominantly one of basic housekeeping. Because of its persistent and recurrent characteristics, the possibility of sabotage cannot be dismissed and investigation will continue. However, the less than effective maintenance and inspection procedures on the part of LAC have been allowed to persist throughout the duration of FOD. The problem has been slightly alleviated, in degrees, by the screen modifications; further improvements, perhaps only partial, hopefully will result from the flapper valve mod.

25X1A

25X1A

8. It was the summary recommendations of [ ] that Project Headquarters immediately insist on a review and correction of the LAC physical management of the Flight Test Program at [ ], coincident with continued intensive investigation of the possibility of sabotage.

~~SECRET~~

~~SECRET~~


25X1A

-2670-63

Page 8

9. As you are aware action has been taken to implement this recommendation.

 25X1A



Chief, Security Staff  
OSA

cc: Director of Security

25X1A

OSA/SS: /mpr (8 May 1963)

Distribution:

- Copy 1 - DAD/OSA
- 2 - DD/R
- 3 - D/Sec
- 4 - AD/OSA
- 5 - D/TECH/OSA
- 6 - D/FA/OSA
- 7 - AFIGO-S
- 8 - O/DDCI
- 9 - SS/OSA
- 10 - RB/OSA
- 11 - PS/OSA

~~SECRET~~



25X1A

**TOP SECRET**

2671-63

Copy 14 of 14

*af*

RECAPITULATION OF AIR ACTIVITIES, WEEK ENDING 8 MAY 1963

PROJECT	VEHICLE	DATE	TARGET COUNTRY	BY	APPROVED	DATE	ACTION
<u>IDEALIST/ TACKLE</u>							
3 Missions	U-2	April	China Mainland to cover Szechwan Basin, Pao Tou, Missile Test Range and South China, as necessary.	Special Group		4 April	1. South China requirements still firm due to failure of GRC-147. Aircraft at [redacted] came in commission 7 May. 2. Subject to views of NPIC and [redacted] is awaiting possible future targeting. COMOR does not recommend recoverage of the Missile Test Range at this time. The present estimate is late June or July. The Szechwan Basin requires further study by COMOR. Weather in these areas was very poor during the period.
						25X1C	
						25X2	
4 Missions	U-2	April and May	Sino/Indian Border	Special Group		4 April	No activity in this area during the period due to lack of [redacted]
						25X1C	[redacted] in the NEFA area. Aircraft being used in Laos/North Vietnam area.
1 Mission	U-2	May or June	North Korea	Special Group		4 April	Weather checked daily. Aircraft out of commission until 7 May. (See Manchuria mission on

**TOP SECRET**

**TOP SECRET**

PROJECT	VEHICLE	DATE	TARGET COUNTRY	BY	APPROVED DATE	ACTION
<u>IDEALIST/ TACKLE</u>						
3 Missions*	U-2	April/ May	Laos/North Vietnam	Special Group	4 April	Mission 3221 completed 1 May 63. Mission 3222 completed 3 May 63. Mission 3223 alerted for launch on 3 May. Delayed daily thru 8 May due deterioration of weather.
1 Mission	U-2	May	Manchuria	Special Group	4 April	This mission planned to cover targets in North Korea and Manchuria. Mission GRC-150 approved for launch on 8 May 63, 2100Z.

\*Special Group approved on 2 May 1963 as many flights as necessary  
to secure adequate coverage of the North Vietnam area.

**TOP SECRET**

**TOP SECRET**

25X1A  
[ ] 2671-63  
Page 3

PROJECT	VEHICLE	DATE	TARGET COUNTRY	BY	APPROVED	DATE	ACTION
[ ]	25X1A						

No activity during period of this report.

OSA/OD/CC/[ ]:rh (8 May 63)

cc: DCI  
ER  
DD/R  
DD/P  
DD/I  
SA/DDR  
DDP/SGO

Distribution:  
#1 - DCI  
#2 - ER  
#3 - DD/R  
#4 - DD/P  
#5 - DD/I  
#6 - AD/OSA  
#7 - DAD/OSA  
#8 - C/OD/OSA  
#9 - SA/DDR  
#10 - INTEL/OSA  
#11 - CC/OD/OSA  
#12 - DDP/SGO  
#13 - D/FA/OSA  
#14 - RB/OSA

**TOP SECRET**