

SECRETONT
51542**PRIORITY**

P 250350Z

FM CIA WASHDC

TO RUCSBR/SAC OFFUTT AFB, OMAHA, NEB

RUCVWB/4080TH STRAT WG, OL 19, BARKSDALE AFB, LA

RUEAHQ/DIAXX

RUECYG/NAVY PIC

RUWGAA/HQS 2ND AF BARKSDALE, LA

RUWGAA/2 RTS, BARKSDALE AFB LA

DA GRNC

BT

S E C R E T

CITE CIA-Z-778

FOR DI, BRASS KNOB, DOCR, DM 4, DIM, SAC HQS, OMAHA. FROM NATIONAL
PHOTOGRAPHIC INTERPRETATION CENTER.

1. CAMERA B 11 WAS USED IN MISSION 3670 FLOWN ON 22 JULY 1963;
PROCESSING WAS ACCOMPLISHED BY BARKSDALE.

2. ORIGINAL NEGATIVE:

A. THE EXPOSURE WAS ADEQUATE AND THE RESOLUTION IS GOOD.

B. 9R SIDE: MINUS DENSITY DOTS OCCUR IN FRAMES 0065
THROUGH 0104. THESE DOTS ARE 1.55" APART AND 1.15" FROM AND
PARALLEL TO THE INBOARD EDGE. THEY APPEAR TO BE CAUSED BY
A PRESSURE POINT ON A 1/2" ROLLER. THERE ARE INK SPOTS IN

25 JUL 1963

HFS ~~AS~~CJS ~~AS~~CFC ~~AS~~PNS ~~AS~~ACL ~~AS~~

Grace (File)

Declassification Review by NGA/DoD

GROUP 1
Excluded from automatic
downgrading and
declassification

SECRET

FRAMES 0217, 0218, 0219, 0357 AND 0358.

C. 9L SIDE: THERE IS A CREASE ASSOCIATED WITH A HEAT SPLICE IN FRAMES 0306 AND 0307. MINUS DENSITY DOTS OCCUR IN FRAME 0613. THESE DOTS ARE 1.6" APART AND ARE LOCATED 0.57" FROM THE INBOARD EDGE. THERE ARE INK SPOTS IN FRAMES 0278 AND 0279.

D. THERE ARE PLUS DENSITY MARKS WHICH APPEAR TO BE CAUSED BY AN ELECTRIC DISCHARGE FROM THE CAMERA PRESSURE ROLLERS. THESE STATIC ELECTRICITY MARKS HAVE BEEN REPORTED IN THE PAST AND ARE INCREASING IN SEVERITY SERIOUSLY DEGRADING FORMAT IMAGERY.

E. OTHER THAN THE STATIC DISCHARGE MARKS THERE WERE NO MAJOR CAMERA MALFUNCTIONS OR PROCESSING ANOMALIES IN THIS MISSION.

3. POSITIVE:

A. THE PI SUITABILITY IS RATED AS FAIR DUE TO OVEREXPOSURE DURING THE PRINTING OF THE POSITIVE.

B. CLOUDS COVERED APPROXIMATELY 25 PERCENT OF THE MISSION.

END OF MESSAGE